




JRP...01


i _{eff}	1500			1000			500			T _{2max} [Nm]	Pr [kW]
	n ₂ [rpm]	T ₂ [Nm]	P ₂ [kW]	n ₂ [rpm]	T ₂ [Nm]	P ₂ [kW]	n ₂ [rpm]	T ₂ [Nm]	P ₂ [kW]		
JRP1N...01											
3.38	444	410	19.1	296	463	14.4	148	570	8.8	1600	12
4.39	342	431	15.4	228	487	11.6	114	600	7.2	1600	
6	250	412	10.8	167	453	7.9	83	510	4.5	1600	
6.94	216	387	8.8	144	407	6.2	72	457	3.5	1600	
10.5	143	206	3.1	95	213	2.1	47.6	224	1.1	1600	
JRP2N...01											
11.42	131	591	8.1	88	667	6.1	43.8	821	3.8	1600	8
14.84	101	639	6.8	67	722	5.1	33.7	889	3.1	1600	
19.27	78	672	5.5	52	759	4.1	25.9	816	2.2	1600	
20.28	74	702	5.4	49.3	793	4.1	24.7	916	2.4	1600	
23.46	64	733	4.9	42.6	828	3.7	21.3	921	2.1	1600	
26.34	57	738	4.4	38	803	3.2	19	825	1.6	1600	
30.47	49.2	771	4	32.8	808	2.8	16.4	829	1.4	1600	
36	41.7	561	2.4	27.8	589	1.7	13.9	636	0.93	1600	
41.64	36	571	2.2	24	599	1.5	12	646	0.81	1600	
48.16	31.1	512	1.7	20.8	537	1.2	10.4	581	0.63	1600	
JRP3N...01											
65.14	23	918	2.2	15.4	931	1.5	7.7	952	0.77	1600	5
68.55	21.9	920	2.1	14.6	933	1.4	7.3	954	0.73	1600	
79.29	18.9	925	1.8	12.6	937	1.2	6.3	958	0.63	1600	
89.03	16.8	928	1.6	11.2	941	1.1	5.6	961	0.57	1600	
103	14.6	933	1.4	9.7	945	1	4.9	966	0.49	1600	
115.6	13	836	1.1	8.6	847	0.77	4.3	865	0.39	1600	
121.7	12.3	938	1.2	8.2	950	0.82	4.1	970	0.42	1600	
140.7	10.7	943	1.1	7.1	955	0.71	3.6	975	0.36	1600	
162.8	9.2	947	0.91	6.1	959	0.62	3.1	979	0.32	1600	
182.8	8.2	848	0.73	5.5	859	0.49	2.7	877	0.25	1600	
211.4	7.1	852	0.63	4.7	863	0.43	2.4	880	0.22	1600	
216	6.9	684	0.5	4.6	732	0.36	2.3	799	0.19	1600	
246.3	6.1	959	0.61	4.1	971	0.41	2	990	0.21	1600	
276.6	5.4	859	0.49	3.6	870	0.33	1.8	887	0.17	1600	
319.9	4.7	863	0.42	3.1	873	0.29	1.6	900	0.15	1600	
372.6	4	824	0.35	2.7	846	0.24	1.3	883	0.12	1600	
378	4	759	0.32	2.6	796	0.22	1.3	854	0.12	1600	
437.2	3.4	786	0.28	2.3	800	0.19	1.1	873	0.11	1600	
484	3.1	874	0.28	2.1	884	0.19	1	961	0.1	1600	
661.5	2.3	800	0.19	1.5	836	0.13	0.76	930	0.07	1600	
765.1	2	772	0.16	1.3	823	0.11	0.65	915	0.06	1600	



径向力（输出轴） Radial force (Output shafts)

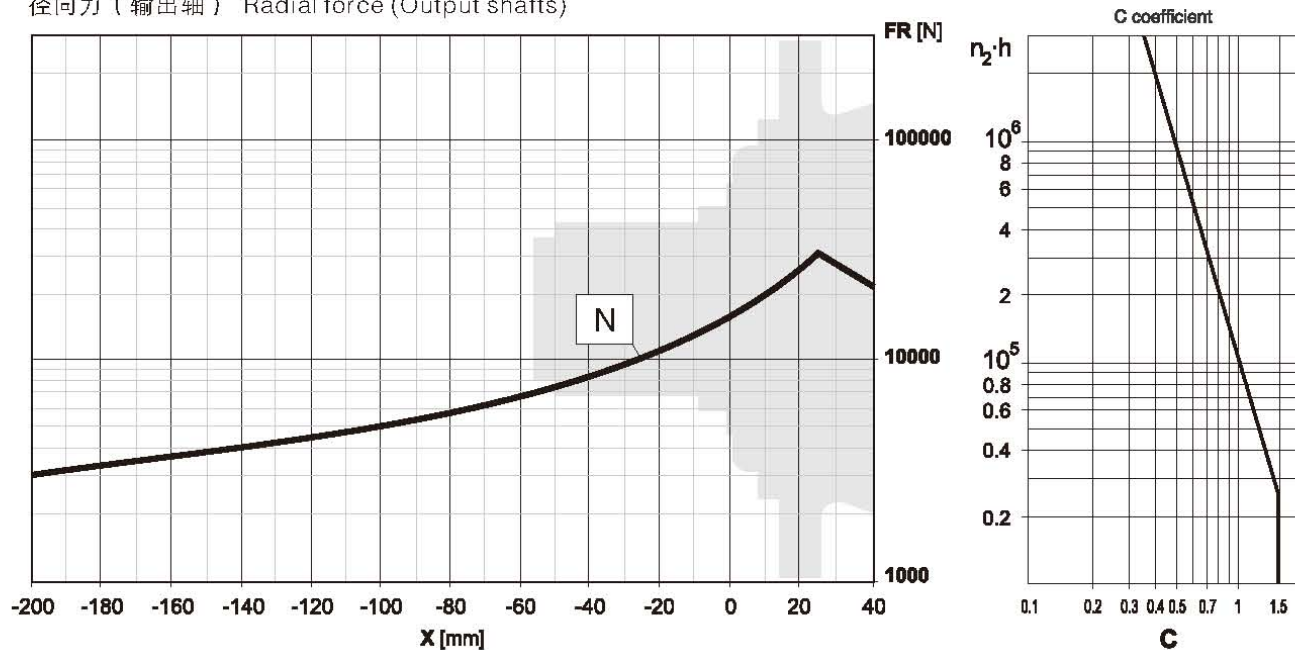


轴向力（输出轴） Axial force (Output shafts)

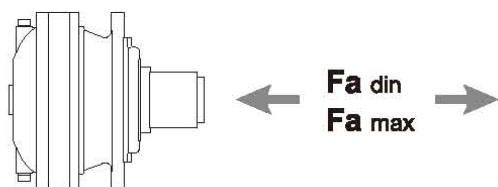

	法兰安装/Flange-mounted
Fa din [N]	9000
Fa max [N]	9000

径向力（输入轴） Radial force (Input shafts)

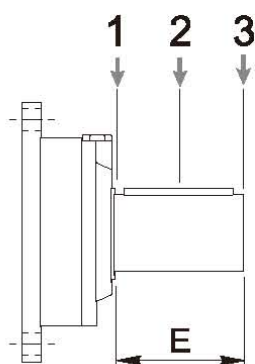

	E	Fr [N]					
		$n_1 \cdot h = 10^7$			$n_1 \cdot h = 10^8$		
		1	2	3	1	2	3
AD2	58	3000	2000	1500	1400	1000	700




JRP...02


i _{eff}	1500			1000			500			T _{2max} [Nm]	P _T [kW]
	n ₂ [rpm]	T ₂ [Nm]	P ₂ [kW]	n ₂ [rpm]	T ₂ [Nm]	P ₂ [kW]	n ₂ [rpm]	T ₂ [Nm]	P ₂ [kW]		
JRP1N...02											
3.08	487	888	45.3	325	1003	34.1	162	1235	21	2800	20
3.5	429	972	43.6	286	1098	32.9	143	1351	20.2	2800	
4.13	363	1005	38.2	242	1135	28.8	121	1397	17.7	2800	
5.17	290	1045	31.8	193	1159	23.5	97	1287	13	2800	
6	250	1001	26.2	167	1077	18.8	83	1187	10.4	2800	
7.25	207	863	18.7	138	924	13.3	69	1015	7.3	2800	
JRP2N...02											
10.41	144	1263	19.1	96	1427	14.4	48	1756	8.8	2800	12
11.83	127	1401	18.6	85	1582	14	42.3	1948	8.6	2800	
13.52	111	1329	15.4	74	1501	11.6	37	1848	7.2	2800	
15.37	98	1510	15.4	65	1705	11.6	32.5	2036	6.9	2800	
18.13	83	1566	13.6	55	1715	9.9	27.6	1840	5.3	2800	
21	71	1445	10.8	47.6	1585	7.9	23.8	1787	4.5	2800	
22.7	66	1348	9.3	44.1	1411	6.5	22	1515	3.5	2800	
24.78	61	1697	10.8	40.4	1772	7.5	20.2	1895	4	2800	
28.66	52	1600	8.8	34.9	1683	6.2	17.4	1890	3.5	2800	
31.02	48.4	1397	7.1	32.2	1458	4.9	16.1	1561	2.6	2800	
35.88	41.8	1419	6.2	27.9	1480	4.3	13.9	1582	2.3	2800	
41.64	36	1305	4.9	24	1360	3.4	12	1453	1.8	2800	
50.32	29.8	1116	3.5	19.9	1164	2.4	9.9	1246	1.3	2800	
JRP3N...02											
59.36	25.3	2071	5.5	16.8	2276	4	8.4	2514	2.2	2800	8
61.28	24.5	1861	4.8	16.3	1933	3.3	8.2	2078	1.8	2800	
70.98	21.1	2121	4.7	14.1	2201	3.2	7	2471	1.8	2800	
82.1	18.3	2150	4.1	12.2	2229	2.8	6.1	2545	1.6	2800	
92.19	16.3	2172	3.7	10.8	2259	2.6	5.4	2606	1.5	2800	
106.6	14.1	2201	3.2	9.4	2329	2.3	4.7	2683	1.3	2800	
108.8	13.8	1963	2.8	9.2	2035	2	4.6	2341	1.1	2800	
126	11.9	1963	2.4	7.9	2062	1.7	4	2228	0.93	2800	
145.7	10.3	1999	2.2	6.9	2097	1.5	3.4	2263	0.81	2800	
161.3	9.3	2333	2.3	6.2	2536	1.6	3.1	2800	0.91	2800	
172	8.7	2049	1.9	5.8	2231	1.4	2.9	2567	0.78	2800	
198.9	7.5	2113	1.7	5	2221	1.2	2.5	2401	0.63	2800	
220.5	6.8	2099	1.5	4.5	2196	1	2.3	2364	0.56	2800	
260.2	5.8	2235	1.3	3.8	2428	0.98	1.9	2785	0.56	2800	
289	5.2	1583	0.86	3.5	1727	0.63	1.7	1994	0.36	2800	
325.7	4.6	1833	0.88	3.1	1995	0.64	1.5	2297	0.37	2800	
JRP4N...02											
360.4	4.2	2748	1.2	2.8	2800	0.82	1.4	2800	0.41	2800	4
404.7	3.7	2800	1.1	2.5	2800	0.73	1.2	2800	0.35	2800	
468.1	3.2	2800	0.94	2.1	2800	0.62	1.1	2800	0.32	2800	
502.5	3	2554	0.8	2	2766	0.58	0.99	2800	0.29	2800	
569.8	2.6	2800	0.76	1.8	2800	0.53	0.88	2800	0.26	2800	
639.8	2.3	2800	0.67	1.6	2800	0.47	0.78	2800	0.23	2800	
708.2	2.1	2800	0.62	1.4	2800	0.41	0.71	2800	0.21	2800	
835.7	1.8	2800	0.53	1.2	2800	0.35	0.6	2800	0.18	2800	
892.1	1.7	2800	0.5	1.1	2800	0.32	0.56	2800	0.16	2800	
1032	1.5	2800	0.44	0.97	2800	0.28	0.48	2800	0.14	2800	
1120	1.3	2800	0.38	0.89	2800	0.26	0.45	2800	0.13	2800	
1323	1.1	2659	0.32	0.76	2789	0.22	0.38	2800	0.11	2800	
1380	1.1	2641	0.3	0.72	2800	0.21	0.36	2800	0.11	2800	
1561	0.96	2800	0.28	0.64	2800	0.19	0.32	2800	0.09	2800	
1806	0.83	2800	0.24	0.55	2800	0.16	0.28	2800	0.08	2800	
1999	0.75	2800	0.22	0.5	2800	0.15	0.25	2800	0.07	2800	
2315	0.65	2800	0.19	0.43	2800	0.13	0.22	2800	0.06	2800	
2615	0.57	2783	0.17	0.38	2800	0.11	0.19	2800	0.06	2800	
2732	0.55	2800	0.16	0.37	2800	0.11	0.18	2800	0.05	2800	
3160	0.47	2800	0.14	0.32	2800	0.09	0.16	2800	0.05	2800	



径向力（输出轴） Radial force (Output shafts)

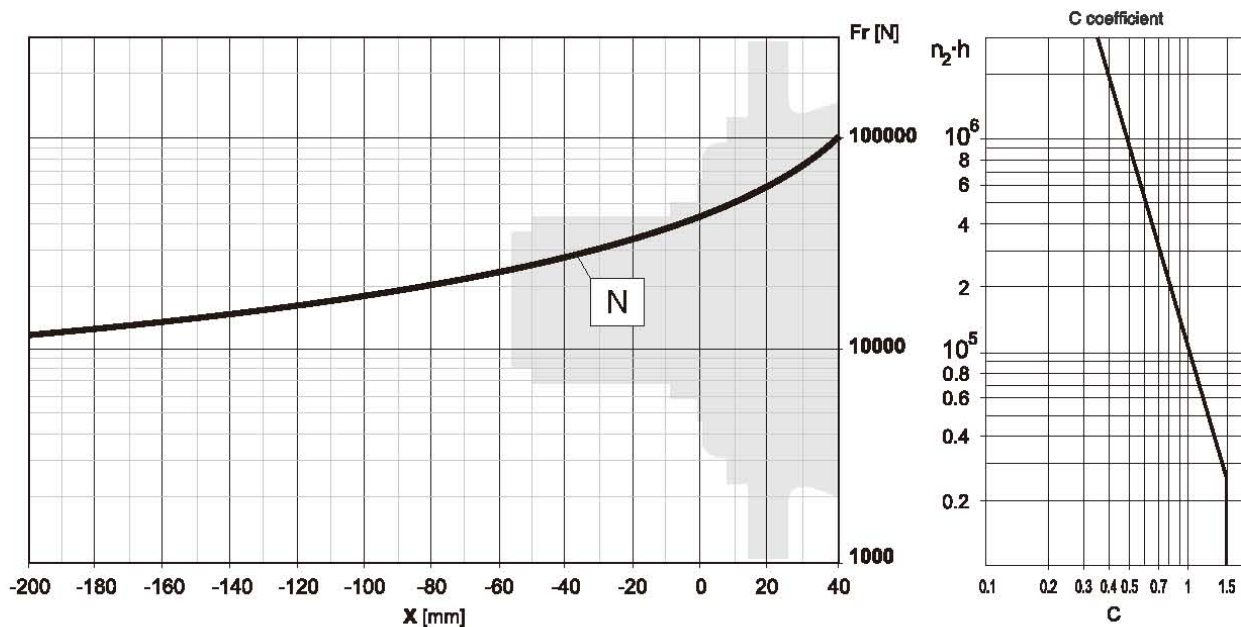


轴向力（输出轴） Axial force (Output shafts)

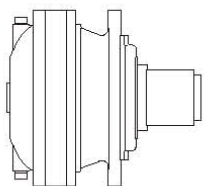


Fa din
Fa max

	法兰安装/Flange-mounted
Fa din[N]	35000
Fa max[N]	60000

径向力（输入轴） Radial force (Input shafts)

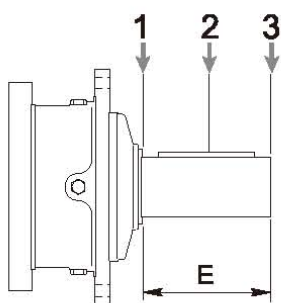

	E	Fr [N]					
		$n_1 \cdot h = 10^7$			$n_1 \cdot h = 10^8$		
		1	2	3	1	2	3
ADM1	105	10000	6000	4000	5000	3000	2000
ADM2	105	14000	8800	6400	7000	4400	3200

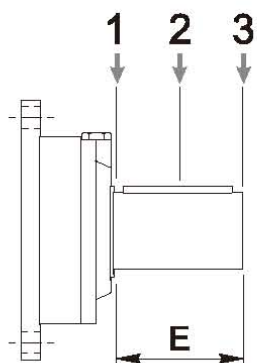

	E	Fr [N]					
		$n_1 \cdot h = 10^7$			$n_1 \cdot h = 10^8$		
		1	2	3	1	2	3
AD2	58	3000	2000	1500	1400	1000	700




JRP...03


i _{eff}	1500			1000			500			T _{2max} [Nm]	P _T [kW]
	n ₂ [rpm]	T ₂ [Nm]	P ₂ [kW]	n ₂ [rpm]	T ₂ [Nm]	P ₂ [kW]	n ₂ [rpm]	T ₂ [Nm]	P ₂ [kW]		
JRP2N...03											
15.37	98	1510	15.4	65	1705	11.6	32.5	2100	7.2	5600	12
17.47	86	2121	19.1	57	2395	14.4	28.6	2732	8.2	6000	
20.28	74	2206	17.1	49.3	2314	12	24.7	2494	6.4	6000	
22.7	66	2231	15.4	44.1	2519	11.6	22	2805	6.5	6000	
26.34	57	2276	13.6	38	2383	9.5	19	2560	5.1	6000	
31.02	48.4	2134	10.8	32.2	2342	7.9	16.1	2639	4.5	6000	
36	41.7	2358	10.3	27.8	2463	7.2	13.9	2640	3.8	6000	
41.64	36	2325	8.8	24	2446	6.2	12	2678	3.4	6000	
43.5	34.5	2027	7.3	23	2119	5.1	11.5	2276	2.7	6000	
50.32	29.8	2060	6.4	19.9	2152	4.5	9.9	2309	2.4	6000	
JRP3N...03											
59.06	25.4	2765	7.4	16.9	2879	5.1	8.5	3076	2.7	6000	8
61.28	24.5	2640	6.8	16.3	2982	5.1	8.2	3671	3.1	6000	
70.98	21.1	2457	5.4	14.1	2775	4.1	7	3206	2.4	6000	
83.76	17.9	2900	5.4	11.9	3275	4.1	6	3783	2.4	6000	
89.03	16.8	2591	4.6	11.2	2695	3.2	5.6	2876	1.7	6000	
96.88	15.5	3029	4.9	10.3	3421	3.7	5.2	3803	2.1	6000	
108.8	13.8	3051	4.4	9.2	3320	3.2	4.6	3410	1.6	6000	
124.2	12.1	2447	3.1	8.1	2528	2.1	4	2658	1.1	6000	
146.6	10.2	2888	3.1	6.8	2983	2.1	3.4	3137	1.1	6000	
157.5	9.5	3042	3	6.3	3179	2.1	3.2	3695	1.2	6000	
186.1	8.1	2901	2.4	5.4	3046	1.7	2.7	3292	0.93	6000	
198.9	7.5	2115	1.7	5	2221	1.2	2.5	2401	0.63	6000	
215.3	7	2953	2.2	4.6	3098	1.5	2.3	3343	0.81	6000	
249	6	2648	1.7	4	2780	1.2	2	3006	0.63	6000	
289	5.2	2924	1.6	3.5	3197	1.2	1.7	3489	0.63	6000	
325.7	4.6	3101	1.5	3.1	3244	1	1.5	3492	0.56	6000	
JRP4N...03											
367.7	4.1	3835	1.6	2.7	3888	1.1	1.4	3972	0.57	6000	4
404.7	3.7	2928	1.1	2.5	2966	0.77	1.2	3029	0.39	6000	
460.3	3.3	3674	1.3	2.2	4000	0.91	1.1	4605	0.52	6000	
495.4	3	3874	1.2	2	3925	0.83	1	4008	0.42	6000	
581.3	2.6	3894	1.1	1.7	3944	0.71	0.86	4027	0.36	6000	
643.5	2.3	3907	0.95	1.6	3956	0.64	0.78	4039	0.33	6000	
691.5	2.2	4002	0.91	1.4	4348	0.66	0.72	4494	0.34	6000	
817.1	1.8	4142	0.8	1.2	4424	0.57	0.61	4516	0.29	6000	
879.4	1.7	3945	0.71	1.1	3994	0.48	0.57	4075	0.24	6000	
1017	1.5	3963	0.61	0.98	4011	0.41	0.49	4092	0.21	6000	
1142	1.3	3550	0.49	0.88	3593	0.33	0.44	3666	0.17	6000	
1304	1.2	2886	0.35	0.77	2961	0.24	0.38	3092	0.12	6000	
1430	1	4445	0.49	0.7	4498	0.33	0.35	4589	0.17	6000	
1539	0.97	3406	0.35	0.65	3494	0.24	0.32	3649	0.12	6000	
1806	0.83	3248	0.28	0.55	3304	0.19	0.28	3607	0.11	6000	
1999	0.75	3610	0.28	0.5	3652	0.19	0.25	3969	0.1	6000	
2268	0.66	4502	0.31	0.44	4781	0.22	0.22	5124	0.12	6000	
2502	0.6	4519	0.28	0.4	4572	0.19	0.2	4969	0.1	6000	
2904	0.52	4726	0.26	0.34	5112	0.18	0.17	5767	0.1	6000	
3170	0.47	4042	0.2	0.32	4382	0.15	0.16	5013	0.08	6000	



径向力（输出轴） Radial force (Output shafts)

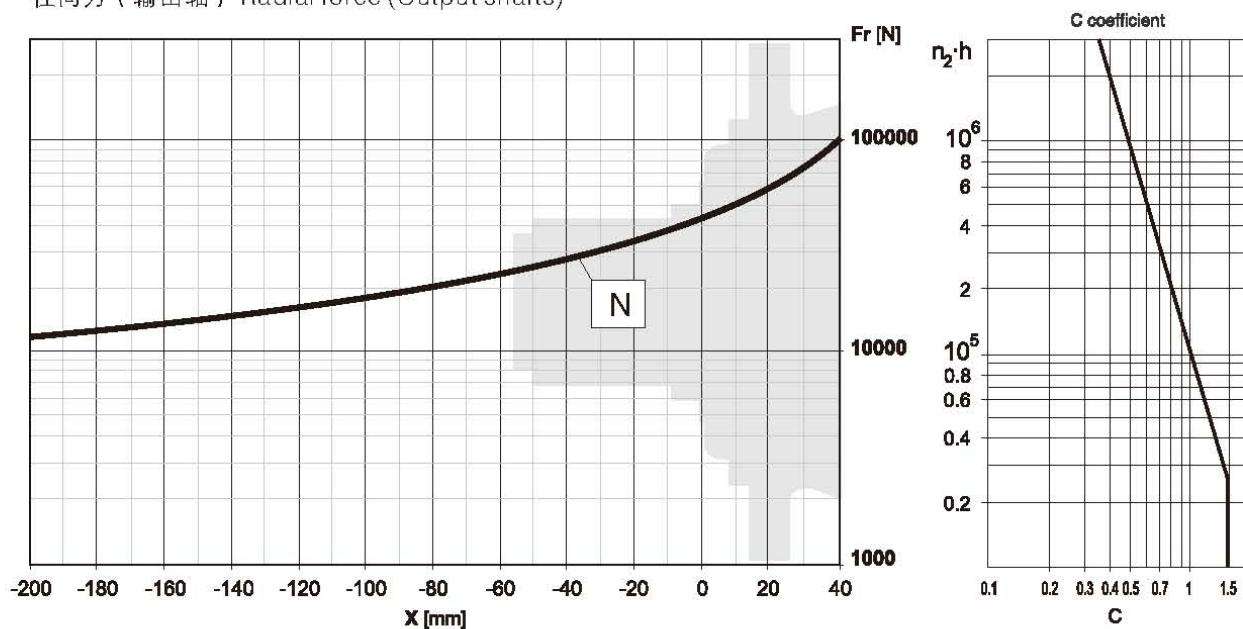


轴向力（输出轴） Axial force (Output shafts)

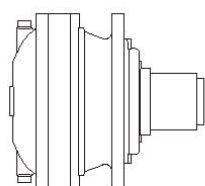

Fa_{din}
 Fa_{max}

	法兰安装/Flange-mounted
Fa_{din} [N]	35000
Fa_{max} [N]	60000

径向力（输入轴） Radial force (Input shafts)

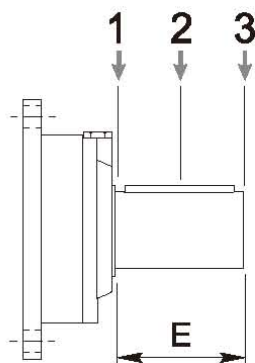

	E	Fr [N]					
		$n_1 \cdot h = 10^7$			$n_1 \cdot h = 10^8$		
		1	2	3	1	2	3
AD2	58	3000	2000	1500	1400	1000	700






JRP...1


i _{eff}	1500			1000			500			T _{2max} [Nm]	P _r [kW]
	n ₂ [rpm]	T ₂ [Nm]	P ₂ [kW]	n ₂ [rpm]	T ₂ [Nm]	P ₂ [kW]	n ₂ [rpm]	T ₂ [Nm]	P ₂ [kW]		
JRP2N...1											
15.37	98	1510	15.4	65	1705	11.6	32.5	2100	7.2	5600	12
17.47	86	2121	19.1	57	2395	14.4	28.6	2732	8.2	6000	
20.28	74	2206	17.1	49.3	2314	12	24.7	2494	6.4	6000	
22.7	66	2231	15.4	44.1	2519	11.6	22	2805	6.5	6000	
26.34	57	2276	13.6	38	2383	9.5	19	2560	5.1	6000	
31.02	48.4	2134	10.8	32.2	2342	7.9	16.1	2639	4.5	6000	
36	41.7	2358	10.3	27.8	2463	7.2	13.9	2640	3.8	6000	
41.64	36	2325	8.8	24	2446	6.2	12	2678	3.4	6000	
43.5	34.5	2027	7.3	23	2119	5.1	11.5	2276	2.7	6000	
50.32	29.8	2060	6.4	19.9	2152	4.5	9.9	2309	2.4	6000	
JRP3N...1											
59.06	25.4	2765	7.4	16.9	2879	5.1	8.5	3076	2.7	6000	8
61.28	24.5	2640	6.8	16.3	2982	5.1	8.2	3671	3.1	6000	
70.98	21.1	2457	5.4	14.1	2775	4.1	7	3206	2.4	6000	
83.76	17.9	2900	5.4	11.9	3275	4.1	6	3783	2.4	6000	
89.03	16.8	2591	4.6	11.2	2695	3.2	5.6	2876	1.7	6000	
96.88	15.5	3029	4.9	10.3	3421	3.7	5.2	3803	2.1	6000	
108.8	13.8	3051	4.4	9.2	3320	3.2	4.6	3410	1.6	6000	
124.2	12.1	2447	3.1	8.1	2528	2.1	4	2658	1.1	6000	
146.6	10.2	2888	3.1	6.8	2983	2.1	3.4	3137	1.1	6000	
157.5	9.5	3042	3	6.3	3179	2.1	3.2	3695	1.2	6000	
186.1	8.1	2901	2.4	5.4	3046	1.7	2.7	3292	0.93	6000	
198.9	7.5	2115	1.7	5	2221	1.2	2.5	2401	0.63	6000	
215.3	7	2953	2.2	4.6	3098	1.5	2.3	3343	0.81	6000	
249	6	2648	1.7	4	2780	1.2	2	3006	0.63	6000	
289	5.2	2924	1.6	3.5	3197	1.2	1.7	3489	0.63	6000	
325.7	4.6	3101	1.5	3.1	3244	1	1.5	3492	0.56	6000	
JRP4N...1											
367.7	4.1	3835	1.6	2.7	3888	1.1	1.4	3972	0.57	6000	4
404.7	3.7	2928	1.1	2.5	2966	0.77	1.2	3029	0.39	6000	
460.3	3.3	3674	1.3	2.2	4000	0.91	1.1	4605	0.52	6000	
495.4	3	3874	1.2	2	3925	0.83	1	4008	0.42	6000	
581.3	2.6	3894	1.1	1.7	3944	0.71	0.86	4027	0.36	6000	
643.5	2.3	3907	0.95	1.6	3956	0.64	0.78	4039	0.33	6000	
691.5	2.2	4002	0.91	1.4	4348	0.66	0.72	4494	0.34	6000	
817.1	1.8	4142	0.8	1.2	4424	0.57	0.61	4516	0.29	6000	
879.4	1.7	3945	0.71	1.1	3994	0.48	0.57	4075	0.24	6000	
1017	1.5	3963	0.61	0.98	4011	0.41	0.49	4092	0.21	6000	
1142	1.3	3550	0.49	0.88	3593	0.33	0.44	3666	0.17	6000	
1304	1.2	2886	0.35	0.77	2961	0.24	0.38	3092	0.12	6000	
1430	1	4445	0.49	0.7	4498	0.33	0.35	4589	0.17	6000	
1539	0.97	3406	0.35	0.65	3494	0.24	0.32	3649	0.12	6000	
1806	0.83	3248	0.28	0.55	3304	0.19	0.28	3607	0.11	6000	
1999	0.75	3610	0.28	0.5	3652	0.19	0.25	3969	0.1	6000	
2268	0.66	4502	0.31	0.44	4781	0.22	0.22	5124	0.12	6000	
2502	0.6	4519	0.28	0.4	4572	0.19	0.2	4969	0.1	6000	
2904	0.52	4726	0.26	0.34	5112	0.18	0.17	5767	0.1	6000	
3170	0.47	4042	0.2	0.32	4382	0.15	0.16	5013	0.08	6000	



径向力（输出轴）Radial force (Output shafts)

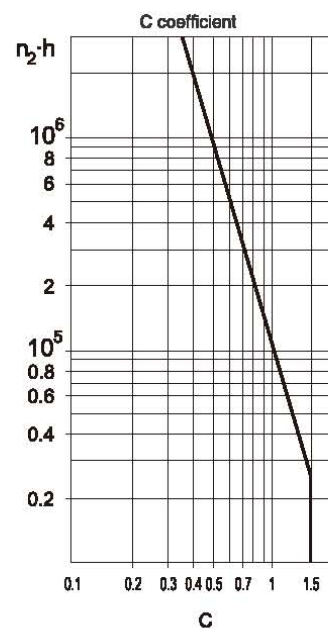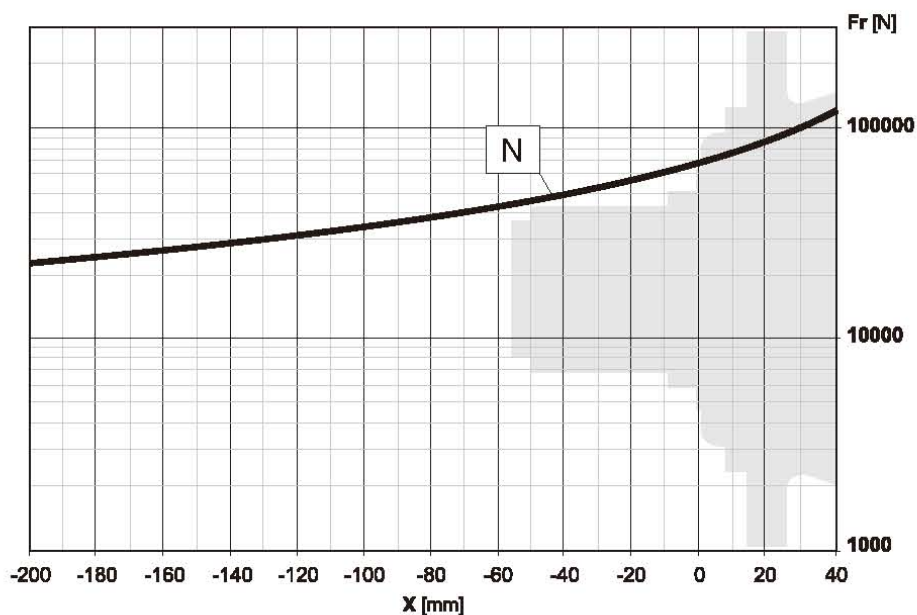


轴向力（输出轴）Axial force (Output shafts)

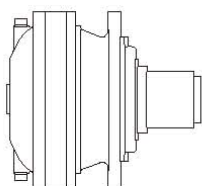

Fa din
Fa max

	法兰安装/Flange-mounted
Fa din[N]	45000
Fa max[N]	80000

径向力（输入轴）Radial force (Input shafts)

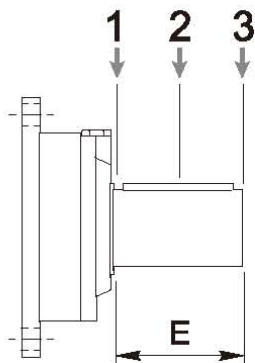

	E	Fr [N]					
		n ₁ · h = 10 ⁷			n ₁ · h = 10 ⁸		
		1	2	3	1	2	3
AD2	58	3000	2000	1500	1400	1000	700




JRP...2


i _{eff}	1500			1000			500			T _{2max} [Nm]	P _T [kW]
	n ₂ [rpm]	T ₂ [Nm]	P ₂ [kW]	n ₂ [rpm]	T ₂ [Nm]	P ₂ [kW]	n ₂ [rpm]	T ₂ [Nm]	P ₂ [kW]		
JRP1N...2											
3.5	429	1565	70	286	1767	53	143	2175	32.6	6000	20
4.13	363	1617	62	242	1827	46.3	121	2249	28.5	6000	
5.17	290	1682	51	193	1900	38.5	97	2339	23.7	6000	
6	250	1732	45.4	167	1956	34.1	83	2173	19	6000	
7.25	207	1582	34.3	138	1695	24.5	69	1868	13.5	6000	
JRP2N...2											
10.78	139	2193	32	93	2476	24.1	46.4	3049	14.8	6000	15
12.25	122	2278	29.2	82	2573	22	40.8	3168	13.5	6000	
14.46	104	2394	26	69	2704	19.6	34.6	3329	12.1	6000	
17.06	88	2475	22.8	59	2795	17.2	29.3	3393	10.4	6000	
18.1	83	2561	22.2	55	2893	16.7	27.6	3562	10.3	6000	
21	71	2678	20	47.6	3025	15.1	23.8	3724	9.3	6000	
25.38	59	2835	17.6	39.4	3202	13.2	19.7	3553	7.3	6000	
29.94	50	2931	15.4	33.4	3310	11.6	16.7	3583	6.3	6000	
31.02	48.4	2582	13.1	32.2	2698	9.1	16.1	2893	4.9	6000	
36	41.7	2358	10.3	27.8	2463	7.2	13.9	2640	3.8	6000	
43.5	34.5	2407	8.7	23	2511	6	11.5	2689	3.2	6000	
52.56	28.5	2070	6.2	19	2161	4.3	9.5	2319	2.3	6000	
JRP3N...2											
53.78	27.9	3552	10.4	18.6	3961	7.7	9.3	4314	4.2	6000	10
63.46	23.6	3732	9.2	15.8	4022	6.6	7.9	4469	3.7	6000	
73.5	20.4	3901	8.3	13.6	4077	5.8	6.8	4609	3.3	6000	
79.44	18.9	3955	7.8	12.6	4106	5.4	6.3	4684	3.1	6000	
92.19	16.3	4010	6.8	10.8	4174	4.7	5.4	4831	2.7	6000	
100.3	15	4042	6.3	10	4250	4.4	5	4915	2.6	6000	
108.6	13.8	4071	5.9	9.2	4323	4.2	4.6	4996	2.4	6000	
125.6	11.9	4125	5.2	8	4459	3.7	4	5146	2.1	6000	
145.7	10.3	4221	4.6	6.9	4601	3.3	3.4	5088	1.8	6000	
152.3	9.9	3846	4	6.6	4014	2.8	3.3	4302	1.5	6000	
176.1	8.5	3907	3.5	5.7	4074	2.4	2.8	4363	1.3	6000	
207.8	7.2	3970	3	4.8	4326	2.2	2.4	4941	1.2	6000	
224.2	6.7	4035	2.8	4.5	4395	2.1	2.2	4798	1.1	6000	
260.2	5.8	4165	2.5	3.8	4532	1.8	1.9	4970	1	6000	
280.7	5.3	3302	1.8	3.6	3605	1.3	1.8	4167	0.78	6000	
314.4	4.8	4334	2.2	3.2	4711	1.6	1.6	5022	0.84	6000	
364.8	4.1	2542	1.1	2.7	2788	0.8	1.4	3244	0.47	6000	
JRP4N...2											
404.7	3.7	5051	2	2.5	5245	1.4	1.2	5615	0.73	6000	6
441	3.4	5312	1.9	2.3	5418	1.3	1.1	5684	0.68	6000	
510.1	2.9	5382	1.7	2	5439	1.1	0.98	5803	0.6	6000	
551.3	2.7	5393	1.5	1.8	5449	1	0.91	5867	0.56	6000	
639.8	2.3	5270	1.3	1.6	5470	0.9	0.78	5992	0.49	6000	
696.2	2.2	5425	1.2	1.4	5495	0.83	0.72	6000	0.45	6000	
773.1	1.9	4524	0.92	1.3	4698	0.64	0.65	5463	0.37	6000	
913.5	1.6	4595	0.79	1.1	4866	0.56	0.55	5662	0.33	6000	
1011	1.5	5477	0.85	0.99	5796	0.6	0.49	6000	0.31	6000	
1140	1.3	5565	0.77	0.88	5895	0.54	0.44	6000	0.28	6000	
1222	1.2	4743	0.61	0.82	5190	0.45	0.41	6021	0.26	6000	
1442	1	5337	0.58	0.69	5652	0.41	0.35	6226	0.23	6000	
1599	0.94	5036	0.5	0.63	5502	0.36	0.31	6366	0.21	6000	
1849	0.81	5200	0.44	0.54	5676	0.32	0.27	6559	0.19	6000	
1995	0.75	4415	0.35	0.5	4530	0.24	0.25	4730	0.12	6000	
2315	0.65	5124	0.35	0.43	5257	0.24	0.22	5489	0.12	6000	
2623	0.57	4633	0.28	0.38	5013	0.2	0.19	5720	0.11	6000	
2798	0.54	5687	0.32	0.36	6000	0.23	0.18	6000	0.11	6000	
3301	0.45	5997	0.29	0.3	6000	0.19	0.15	6000	0.09	6000	



径向力（输出轴） Radial force (Output shafts)

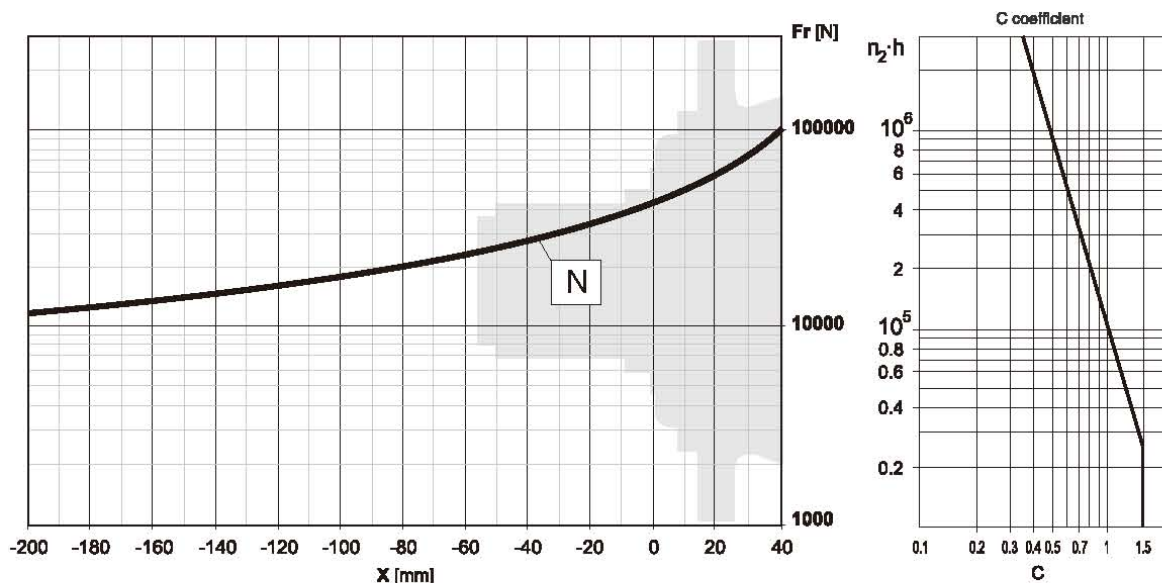


轴向力（输出轴） Axial force (Output shafts)

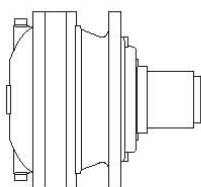


Fa din
Fa max

	法兰安装/Flange-mounted
Fa din[N]	35000
Fa max[N]	60000

径向力（输入轴） Radial force (Input shafts)

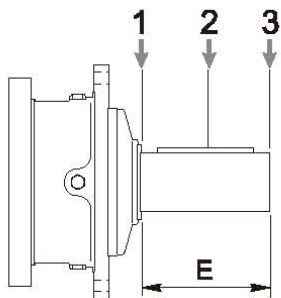

	E	Fr[N]					
		n ₁ · h = 10 ⁷			n ₁ · h = 10 ⁸		
		1	2	3	1	2	3
ADM1	105	10000	6000	4000	5000	3000	2000
ADM2	105	104000	8800	6400	7000	4400	3200

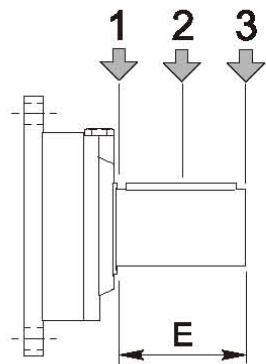

	E	Fr[N]					
		n ₁ · h = 10 ⁷			n ₁ · h = 10 ⁸		
		1	2	3	1	2	3
AD2	58	3000	2000	1500	1400	1000	700




JRP...3


i _{eff}	1500			1000			500			T _{2max} [Nm]	P _T [kW]
	n ₂ [rpm]	T ₂ [Nm]	P ₂ [kW]	n ₂ [rpm]	T ₂ [Nm]	P ₂ [kW]	n ₂ [rpm]	T ₂ [Nm]	P ₂ [kW]		
JRP1N...3											
3.5	429	1565	70	286	1767	53	143	2175	32.6	6000	20
4.13	363	1617	62	242	1827	46.3	121	2249	28.5	6000	
5.17	290	1682	51	193	1900	38.5	97	2339	23.7	6000	
6	250	1732	45.4	167	1956	34.1	83	2173	19	6000	
7.25	207	1582	34.3	138	1695	24.5	69	1868	13.5	6000	
JRP2N...3											
10.78	139	2193	32	93	2476	24.1	46.4	3049	14.8	6000	15
12.25	122	2278	29.2	82	2573	22	40.8	3168	13.5	6000	
14.46	104	2394	26	69	2704	19.6	34.6	3329	12.1	6000	
17.06	88	2475	22.8	59	2795	17.2	29.3	3393	10.4	6000	
18.1	83	2561	22.2	55	2893	16.7	27.6	3562	10.3	6000	
21	71	2678	20	47.6	3025	15.1	23.8	3724	9.3	6000	
25.38	59	2835	17.6	39.4	3202	13.2	19.7	3553	7.3	6000	
29.94	50	2931	15.4	33.4	3310	11.6	16.7	3583	6.3	6000	
31.02	48.4	2582	13.1	32.2	2698	9.1	16.1	2893	4.9	6000	
36	41.7	2358	10.3	27.8	2463	7.2	13.9	2640	3.8	6000	
43.5	34.5	2407	8.7	23	2511	6	11.5	2689	3.2	6000	
52.56	28.5	2070	6.2	19	2161	4.3	9.5	2319	2.3	6000	
JRP3N...3											
53.78	27.9	3552	10.4	18.6	3961	7.7	9.3	4314	4.2	6000	10
63.46	23.6	3732	9.2	15.8	4022	6.6	7.9	4469	3.7	6000	
73.5	20.4	3901	8.3	13.6	4077	5.8	6.8	4609	3.3	6000	
79.44	18.9	3955	7.8	12.6	4106	5.4	6.3	4684	3.1	6000	
92.19	16.3	4010	6.8	10.8	4174	4.7	5.4	4831	2.7	6000	
100.3	15	4042	6.3	10	4250	4.4	5	4915	2.6	6000	
108.6	13.8	4071	5.9	9.2	4323	4.2	4.6	4996	2.4	6000	
125.6	11.9	4125	5.2	8	4459	3.7	4	5146	2.1	6000	
145.7	10.3	4221	4.6	6.9	4601	3.3	3.4	5088	1.8	6000	
152.3	9.9	3846	4	6.6	4014	2.8	3.3	4302	1.5	6000	
176.1	8.5	3907	3.5	5.7	4074	2.4	2.8	4363	1.3	6000	
207.8	7.2	3970	3	4.8	4326	2.2	2.4	4941	1.2	6000	
224.2	6.7	4035	2.8	4.5	4395	2.1	2.2	4798	1.1	6000	
260.2	5.8	4165	2.5	3.8	4532	1.8	1.9	4970	1	6000	
280.7	5.3	3302	1.8	3.6	3605	1.3	1.8	4167	0.78	6000	
314.4	4.8	4334	2.2	3.2	4711	1.6	1.6	5022	0.84	6000	
364.8	4.1	2542	1.1	2.7	2788	0.8	1.4	3244	0.47	6000	
JRP4N...3											
404.7	3.7	5051	2	2.5	5245	1.4	1.2	5615	0.73	6000	6
441	3.4	5312	1.9	2.3	5418	1.3	1.1	5684	0.68	6000	
510.1	2.9	5382	1.7	2	5439	1.1	0.98	5803	0.6	6000	
551.3	2.7	5393	1.5	1.8	5449	1	0.91	5867	0.56	6000	
639.8	2.3	5270	1.3	1.6	5470	0.9	0.78	5992	0.49	6000	
696.2	2.2	5425	1.2	1.4	5495	0.83	0.72	6000	0.45	6000	
773.1	1.9	4524	0.92	1.3	4698	0.64	0.65	5463	0.37	6000	
913.5	1.6	4595	0.79	1.1	4866	0.56	0.55	5662	0.33	6000	
1011	1.5	5477	0.85	0.99	5796	0.6	0.49	6000	0.31	6000	
1140	1.3	5565	0.77	0.88	5895	0.54	0.44	6000	0.28	6000	
1222	1.2	4743	0.61	0.82	5190	0.45	0.41	6021	0.26	6000	
1442	1	5337	0.58	0.69	5652	0.41	0.35	6226	0.23	6000	
1599	0.94	5036	0.5	0.63	5502	0.36	0.31	6366	0.21	6000	
1849	0.81	5200	0.44	0.54	5676	0.32	0.27	6559	0.19	6000	
1995	0.75	4415	0.35	0.5	4530	0.24	0.25	4730	0.12	6000	
2315	0.65	5124	0.35	0.43	5257	0.24	0.22	5489	0.12	6000	
2623	0.57	4633	0.28	0.38	5013	0.2	0.19	5720	0.11	6000	
2798	0.54	5687	0.32	0.36	6000	0.23	0.18	6000	0.11	6000	
3301	0.45	5997	0.29	0.3	6000	0.19	0.15	6000	0.09	6000	



径向力（输出轴）Radial force (Output shafts)

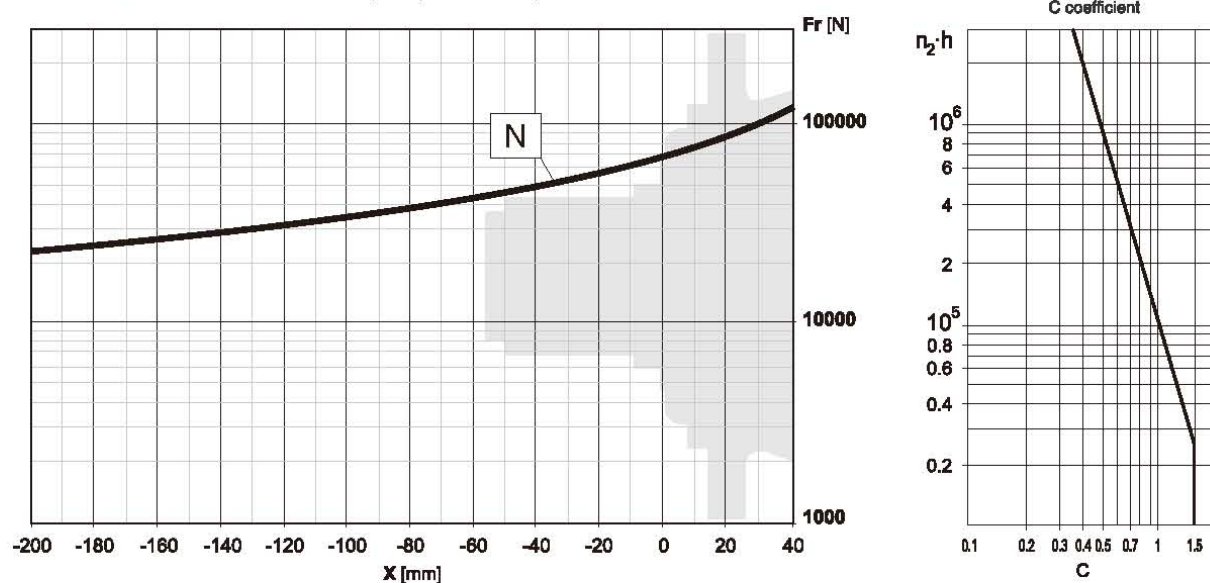


轴向力（输出轴）Axial force (Output shafts)

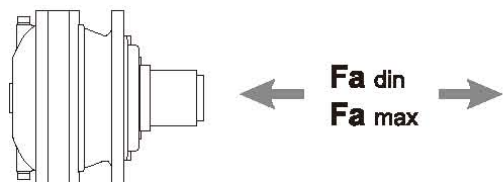


	法兰安装/Flange-mounted
Fa din [N]	45000
Fa max [N]	80000

径向力（输入轴）Radial force (Input shafts)

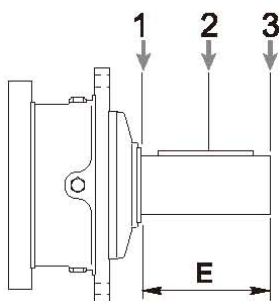

	E	Fr [N]					
		n ₁ · h = 10 ⁷			n ₁ · h = 10 ⁸		
		1	2	3	1	2	3
ADM1	105	10000	6000	4000	5000	3000	2000
ADM2	105	104000	8800	6400	7000	4400	3200

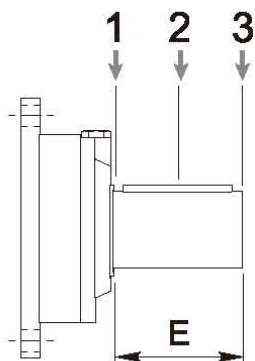

	E	Fr [N]					
		n ₁ · h = 10 ⁷			n ₁ · h = 10 ⁸		
		1	2	3	1	2	3
AD2	58	3000	2000	1500	1400	1000	700




JRP...4


i _{eff}	1500			1000			500			T _{2max} [Nm]	P _T [kW]
	n ₂ [rpm]	T ₂ [Nm]	P ₂ [kW]	n ₂ [rpm]	T ₂ [Nm]	P ₂ [kW]	n ₂ [rpm]	T ₂ [Nm]	P ₂ [kW]		
JRP1N...4											
3.5	429	2241	101	286	2531	76	143	3116	46.6	10000	30
3.86	389	2307	94	259	2605	71	130	3207	43.5	10000	
4.33	346	2346	85	231	2650	64	115	3262	39.5	10000	
5	300	2401	75	200	2712	57	100	3338	35	10000	
6	250	2502	66	167	2826	49.3	83	3480	30.4	10000	
JRP2N...4											
10.78	139	3110	45.3	93	3512	34.1	46.4	4324	21	9800	18
12.25	122	3264	41.9	82	3686	31.5	40.8	4538	19.4	9800	
13.51	111	3359	39.1	74	3794	29.4	37	4671	18.1	10000	
15.16	99	3417	35.4	66	3859	26.7	33	4751	16.4	10000	
17.88	84	3590	31.5	56	4055	23.8	28	4992	14.6	10000	
20.65	73	3674	28	48.4	4150	21	24.2	5109	13	10000	
22.39	67	3841	27	44.7	4338	20.3	22.3	5340	12.5	10000	
25.98	58	4016	24.3	38.5	4536	18.3	19.2	5140	10.4	10000	
27.99	54	3334	18.7	35.7	3567	13.3	17.9	3918	7.3	10000	
30	50	4110	21.5	33.3	4642	16.2	16.7	5479	9.6	10000	
36.25	41.4	4319	18.7	27.6	4620	13.3	13.8	5075	7.3	10000	
43.5	34.5	3971	14.3	23	4137	10	11.5	4422	5.3	10000	
JRP3N...4											
51.22	29.3	4924	15.1	19.5	5561	11.4	9.8	6150	6.3	10000	14
53.78	27.9	5087	14.9	18.6	5745	11.2	9.3	7073	6.9	10000	
60.44	24.8	5174	13.4	16.5	5844	10.1	8.3	6246	5.4	10000	
73.5	20.4	5058	10.8	13.6	5549	7.9	6.8	6254	4.5	10000	
78.51	19.1	5597	11.2	12.7	6005	8	6.4	6603	4.4	10000	
90.93	16.5	5849	10.1	11	6085	7	5.5	6810	3.9	10000	
98.27	15.3	5841	9.3	10.2	6112	6.5	5.1	6560	3.5	10000	
110.6	13.6	6079	8.6	9	6361	6	4.5	7297	3.5	10000	
123.9	12.1	5642	7.2	8.1	5851	4.9	4	6651	2.8	10000	
134.3	11.2	6051	7.1	7.4	6315	4.9	3.7	6760	2.6	10000	
155.1	9.7	5757	5.8	6.4	6024	4.1	3.2	6968	2.4	10000	
180	8.3	5834	5.1	5.6	6219	3.6	2.8	7170	2.1	10000	
208.2	7.2	5910	4.5	4.8	6413	3.2	2.4	7269	1.8	10000	
217.5	6.9	5495	4	4.6	5735	2.8	2.3	6146	1.5	10000	
251.6	6	5581	3.5	4	5821	2.4	2	6233	1.3	10000	
272.8	5.5	5375	3.1	3.7	5552	2.1	1.8	5838	1.1	10000	
JRP4N...4											
322.7	4.6	7604	3.7	3.1	7906	2.6	1.5	9121	1.5	10000	8
373.2	4	7704	3.2	2.7	8152	2.3	1.3	9392	1.3	10000	
411.6	3.6	7683	2.9	2.4	8332	2.1	1.2	9537	1.2	10000	
441	3.4	6873	2.4	2.3	7218	1.7	1.1	7800	0.93	10000	
510.1	2.9	6998	2.2	2	7341	1.5	0.98	7923	0.81	10000	
555.3	2.7	7619	2.2	1.8	7992	1.5	0.9	8626	0.81	10000	
631.1	2.4	8077	2	1.6	8750	1.5	0.79	9802	0.81	10000	
696.2	2.2	7397	1.7	1.4	7774	1.2	0.72	8406	0.63	10000	
771.8	1.9	7348	1.5	1.3	7688	1	0.65	8274	0.56	10000	
892.7	1.7	6595	1.2	1.1	6907	0.81	0.56	7448	0.44	10000	
994.6	1.5	8119	1.3	1	8789	0.93	0.5	10000	0.52	10000	
1104	1.4	8159	1.2	0.91	8545	0.81	0.45	9215	0.44	10000	
1303	1.2	9309	1.1	0.77	10000	0.81	0.38	10000	0.4	10000	
1445	1	7916	0.86	0.69	8637	0.63	0.35	9973	0.36	10000	
1631	0.92	8185	0.79	0.61	8905	0.57	0.31	10000	0.32	10000	
1884	0.8	9194	0.77	0.53	9932	0.55	0.27	10000	0.26	10000	
2095	0.72	7243	0.54	0.48	7839	0.39	0.24	8946	0.22	10000	
2186	0.69	8653	0.62	0.46	9419	0.45	0.23	10000	0.24	10000	
2468	0.61	5462	0.35	0.41	5604	0.24	0.2	5852	0.12	10000	
2850	0.53	6307	0.35	0.35	6471	0.24	0.18	6757	0.12	10000	
3170	0.47	7852	0.39	0.32	8486	0.28	0.16	9665	0.16	10000	



径向力（输出轴） Radial force (Output shafts)

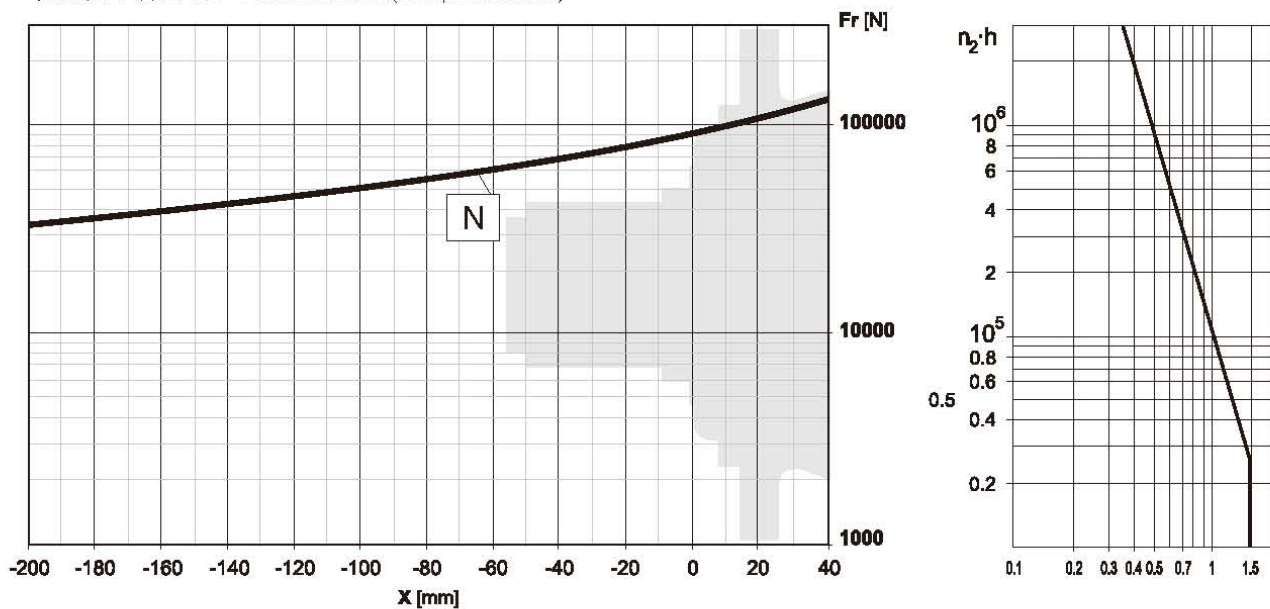


轴向力（输出轴） Axial force (Output shafts)

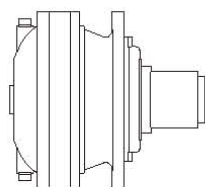


Fa_{din}
 Fa_{max}

	法兰安装/Flange-mounted
Fa_{din} [N]	50000
Fa_{max} [N]	90000

径向力（输入轴） Radial force (Input shafts)

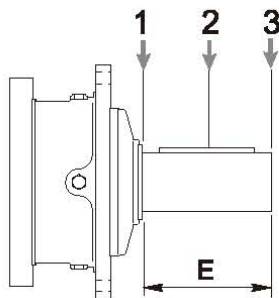

	E	Fr [N]					
		$n_1 \cdot h = 10^7$			$n_1 \cdot h = 10^8$		
		1	2	3	1	2	3
ADM1	105	10000	6000	4000	5000	3000	2000
ADM2	105	14000	8800	6400	7000	4400	3200
ADM3	130	23800	15500	9600	11900	7800	4800

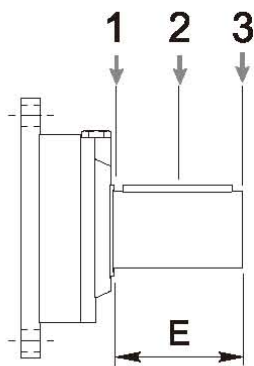

	E	Fr [N]					
		$n_1 \cdot h = 10^7$			$n_1 \cdot h = 10^8$		
		1	2	3	1	2	3
AD2	58	3000	2000	1500	1400	1000	700




JRP...5


ieff	1500			1000			500			T2max [Nm]	PT [kW]
	n2 [rpm]	T2 [Nm]	P2 [kW]	n2 [rpm]	T2 [Nm]	P2 [kW]	n2 [rpm]	T2 [Nm]	P2 [kW]		
JRP2N...5											
12.25	122	3264	41.9	82	3686	31.5	40.8	4538	19.4	9800	18
14.46	104	3430	37.3	69	3874	28.1	34.6	4769	17.3	9800	
15.16	99	3417	35.4	66	3859	26.7	33	4751	16.4	10000	
18.1	83	3669	31.9	55	4144	24	27.6	5102	14.8	10000	
21	71	3837	28.7	47.6	4333	21.6	23.8	5335	13.3	10000	
22.39	67	3841	27	44.7	4338	20.3	22.3	5340	12.5	10000	
25.38	59	4061	25.1	39.4	4586	18.9	19.7	5646	11.7	10000	
27.99	54	4179	23.5	35.7	4720	17.7	17.9	5811	10.9	10000	
31.39	47.8	4251	21.3	31.9	4801	16	15.9	5885	9.8	10000	
36.25	41.4	4350	18.9	27.6	4913	14.2	13.8	5575	8.1	10000	
43.5	34.5	3971	14.3	23	4137	10	11.5	4422	5.3	10000	
JRP3N...5											
50.59	29.6	4995	15.5	19.8	5641	11.7	9.9	6945	7.2	10000	14
55.8	26.9	5141	14.5	17.9	5806	10.9	9	6373	6	10000	
63.33	23.7	5343	13.3	15.8	6034	10	7.9	7366	6.1	10000	
73.5	20.4	5587	11.9	13.6	6310	9	6.8	7597	5.4	10000	
78.35	19.1	5593	11.2	12.8	6004	8	6.4	6600	4.4	10000	
88.81	16.9	5914	10.5	11.3	6678	7.9	5.6	7898	4.7	10000	
104.8	14.3	6215	9.3	9.5	7018	7	4.8	8169	4.1	10000	
108.6	13.8	5968	8.6	9.2	6188	6	4.6	7082	3.4	10000	
126	11.9	6568	8.2	7.9	7358	6.1	4	8478	3.5	10000	
144.7	10.4	6227	6.8	6.9	6734	4.9	3.5	7766	2.8	10000	
152.3	9.8	6180	6.4	6.6	6649	4.6	3.3	7668	2.6	10000	
184	8.2	6297	5.4	5.4	6860	3.9	2.7	7901	2.2	10000	
202.9	7.4	6639	5.1	4.9	7224	3.7	2.5	8308	2.1	10000	
227.6	6.6	6556	4.5	4.4	7134	3.3	2.2	8205	1.9	10000	
262.8	5.7	6183	3.7	3.8	6733	2.7	1.9	7753	1.5	10000	
315.4	4.8	4894	2.4	3.2	5343	1.8	1.6	6175	1	10000	



径向力（输出轴）Radial force (Output shafts)

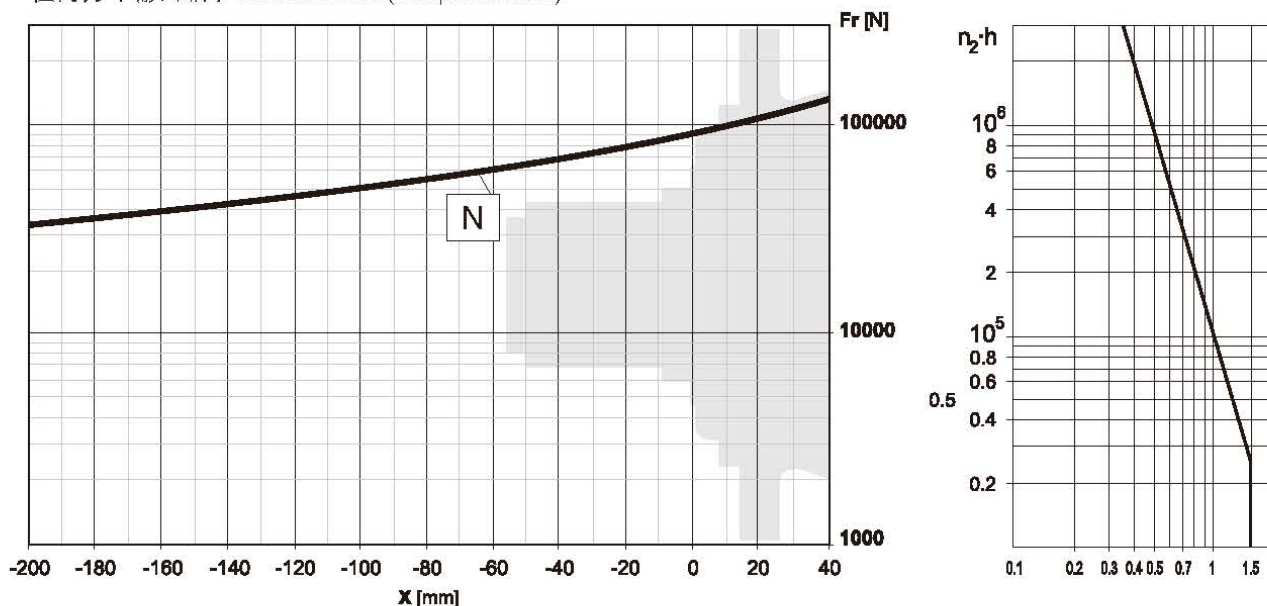


轴向力（输出轴）Axial force (Output shafts)

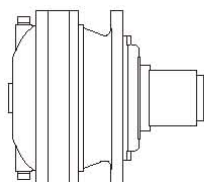


Fa din
Fa max

	法兰安装/Flange-mounted
Fa din[N]	50000
Fa max[N]	90000

径向力（输入轴）Radial force (Input shafts)

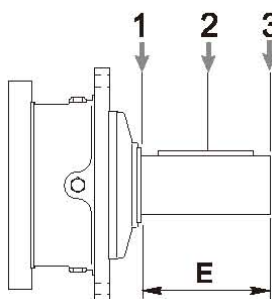

	E	Fr[N]					
		n ₁ · h = 10 ⁷			n ₁ · h = 10 ⁸		
		1	2	3	1	2	3
ADM1	105	10000	6000	4000	5000	3000	2000
ADM2	105	14000	8800	6400	7000	4400	3200
ADM3	130	23800	15500	9600	11900	7800	4800

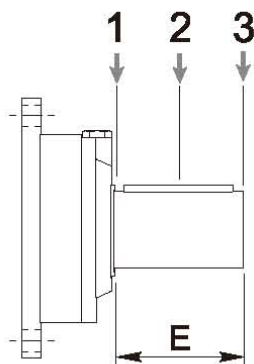

	E	Fr[N]					
		n ₁ · h = 10 ⁷			n ₁ · h = 10 ⁸		
		1	2	3	1	2	3
AD2	58	3000	2000	1500	1400	1000	700




JRP...6


i _{eff}	1500			1000			500			T _{2max} [Nm]	P _T [kW]
	n ₂ [rpm]	T ₂ [Nm]	P ₂ [kW]	n ₂ [rpm]	T ₂ [Nm]	P ₂ [kW]	n ₂ [rpm]	T ₂ [Nm]	P ₂ [kW]		
JRP1N...6											
4.08	368	2936	113	245	3316	85	123	4082	52	15000	40
5.05	297	3054	95	198	3449	72	99	4246	44	15000	
5.81	258	3122	84	172	3526	64	86	4341	39.1	15000	
6.92	217	3246	74	145	3666	55	72	4514	34.2	15000	
8.7	172	2868	52	115	3077	37	57	3396	20.4	15000	
JRP2N...6											
14.28	105	4276	47	70	4829	35.4	35	5945	21.8	15000	23
16.85	89	4493	41.9	59	5075	31.5	29.7	6248	19.4	15000	
17.68	85	4447	39.5	57	5022	29.8	28.3	6184	18.3	15000	
21.09	71	4807	35.8	47.4	5428	27	23.7	6683	16.6	15000	
24.48	61	5026	32.3	40.8	5676	24.3	20.4	6989	14.9	15000	
29.58	51	5320	28.3	33.8	6008	21.3	16.9	7397	13.1	15000	
30.3	49.5	5228	27.1	33	5904	20.4	16.5	7269	12.6	15000	
36.61	41	5533	23.7	27.3	6249	17.9	13.7	7693	11	15000	
41.52	36.1	4902	18.5	24.1	5107	12.9	12	5456	6.9	15000	
44.98	33.3	3629	12.7	22.2	3800	8.8	11.1	4092	4.8	15000	
50.17	29.9	4998	15.7	19.9	5202	10.9	10	5552	5.8	15000	
JRP3N...6											
58.98	25.4	6543	17.4	17	7390	13.1	8.5	9098	8.1	15000	15
61.86	24.2	6476	16.4	16.2	7314	12.4	8.1	8304	7	15000	
73.83	20.3	7000	14.9	13.5	7905	11.2	6.8	9732	6.9	15000	
75.4	19.9	7044	14.7	13.3	7955	11.1	6.6	9794	6.8	15000	
87.12	17.2	7356	13.3	11.5	8308	10	5.7	10228	6.1	15000	
101.1	14.8	7692	12	9.9	8687	9	4.9	10384	5.4	15000	
109.1	13.8	7869	11.3	9.2	8887	8.5	4.6	10941	5.3	15000	
126.6	11.9	8228	10.2	7.9	9293	7.7	4	11441	4.7	15000	
146.9	10.2	8604	9.2	6.8	9717	6.9	3.4	10774	3.8	15000	
152.9	9.8	8709	8.9	6.5	9835	6.7	3.3	12023	4.1	15000	
177.5	8.5	9107	8.1	5.6	10248	6	2.8	10973	3.2	15000	
209.2	7.2	7381	5.5	4.8	7820	3.9	2.4	8994	2.3	15000	
219.7	6.8	8429	6	4.6	9159	4.4	2.3	10512	2.5	15000	
252.7	5.9	7502	4.7	4	8129	3.4	2	9337	1.9	15000	
265.4	5.7	8765	5.2	3.8	9515	3.8	1.9	10906	2.2	15000	
305.4	4.9	7776	4	3.3	8446	2.9	1.6	9689	1.7	15000	
363.7	4.1	6105	2.6	2.7	6649	1.9	1.4	7657	1.1	15000	
JRP4N...6											
409.3	3.7	11701	4.5	2.4	12828	3.3	1.2	13665	1.7	15000	11
443	3.4	11982	4.2	2.3	12979	3.1	1.1	13813	1.6	15000	
512.4	2.9	12392	3.8	2	13025	2.7	0.98	14090	1.4	15000	
555.6	2.7	12244	3.5	1.8	12716	2.4	0.9	14246	1.3	15000	
654.3	2.3	12434	3	1.5	13023	2.1	0.76	14565	1.2	15000	
718.5	2.1	13004	2.8	1.4	13423	2	0.7	14750	1.1	15000	
779.1	1.9	11377	2.3	1.3	11906	1.6	0.64	13853	0.93	15000	
878.3	1.7	12778	2.3	1.1	13797	1.6	0.57	15000	0.9	15000	
1019	1.5	11665	1.8	0.98	12638	1.3	0.49	14664	0.75	15000	
1145	1.3	13474	1.8	0.87	14304	1.3	0.44	15000	0.69	15000	
1232	1.2	12047	1.5	0.81	13170	1.1	0.41	15000	0.64	15000	
1329	1.1	13813	1.6	0.75	14595	1.2	0.38	15000	0.6	15000	
1606	0.93	14174	1.4	0.62	14973	0.98	0.31	15000	0.49	15000	
1864	0.8	13195	1.1	0.54	14389	0.81	0.27	15000	0.42	15000	
1988	0.75	12975	1	0.5	13987	0.74	0.25	15000	0.39	15000	
2307	0.65	13340	0.91	0.43	14375	0.65	0.22	15000	0.35	15000	
2524	0.59	9025	0.56	0.4	9751	0.41	0.2	11100	0.23	15000	
2787	0.54	13815	0.78	0.36	14880	0.56	0.18	15000	0.28	15000	
3207	0.47	12288	0.6	0.31	13240	0.43	0.16	15000	0.25	15000	



径向力（输出轴）Radial force (Output shafts)

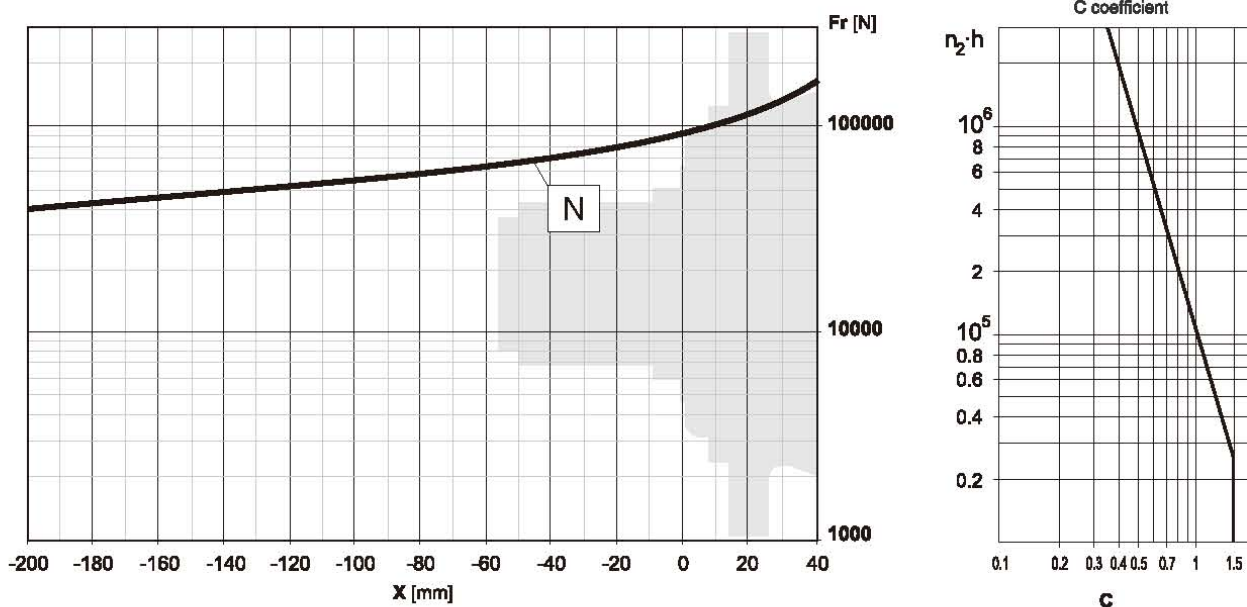


轴向力（输出轴）Axial force (Output shafts)

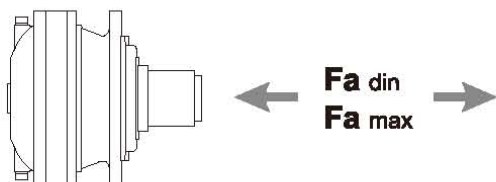


	法兰安装/Flange-mounted
Fa_{din} [N]	48000
Fa_{max} [N]	60000

径向力（输入轴）Radial force (Input shafts)

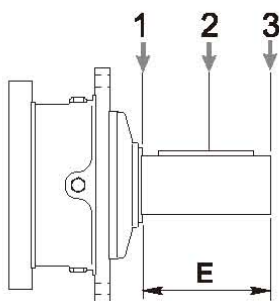

	E	Fr [N]					
		$n_1 \cdot h = 10^7$			$n_1 \cdot h = 10^8$		
		1	2	3	1	2	3
ADM1	105	10000	6000	4000	5000	3000	2000
ADM2	105	14000	8800	6400	7000	4400	3200
ADM3	130	23800	15500	9600	11900	7800	4800

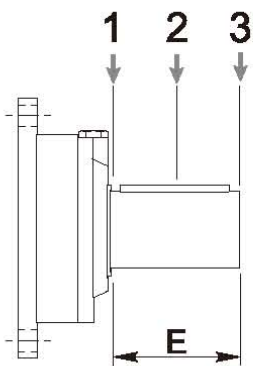

	E	Fr [N]					
		$n_1 \cdot h = 10^7$			$n_1 \cdot h = 10^8$		
		1	2	3	1	2	3
AD2	58	3000	2000	1500	1400	1000	700




JRP...7


i _{eff}	1500			1000			500			T _{zmax} [Nm]	P _r [kW]
	n _z [rpm]	T _z [Nm]	P _z [kW]	n _z [rpm]	T _z [Nm]	P _z [kW]	n _z [rpm]	T _z [Nm]	P _z [kW]		
JRP1N...7											
3.9	385	4758	192	256	5374	144	128	6616	89	20000	40
5.14	292	5006	153	195	5654	115	97	6961	71	20000	
6.27	239	5178	130	159	5847	98	80	7199	60	20000	
JRP2N...7											
13.65	110	6103	70	73	6893	53	36.6	8486	32.6	20000	23
16.11	93	6309	62	62	7125	46.3	31	8772	28.5	20000	
17.99	83	7290	64	56	8233	47.9	27.8	9317	27.1	20000	
20.16	74	6563	51	50	7412	38.5	24.8	9125	23.7	20000	
21.95	68	7540	54	45.6	8220	39.2	22.8	8771	20.9	20000	
26.57	56	8195	48.4	37.6	9057	35.7	18.8	9649	19	20000	
28.28	53	6170	34.3	35.4	6613	24.5	17.7	7286	13.5	20000	
30.84	48.6	8570	43.7	32.4	9185	31.2	16.2	9776	16.6	20000	
37.27	40.3	8132	34.3	26.8	8716	24.5	13.4	9603	13.5	20000	
45.46	33	8477	29.3	22	8799	20.3	11	9353	10.8	20000	
JRP3N...7											
47.78	31.4	8888	29.2	20.9	10037	22	10.5	12357	13.5	20000	15
56.37	26.6	9340	26	17.7	10548	19.6	8.9	12986	12.1	20000	
62.96	23.8	9448	23.6	15.9	9794	16.3	7.9	10392	8.6	20000	
70.57	21.3	9991	22.2	14.2	11283	16.7	7.1	13892	10.3	20000	
81.9	18.3	10447	20	12.2	11799	15.1	6.1	14526	9.3	20000	
93.01	16.1	9781	16.5	10.8	10129	11.4	5.4	11021	6.2	20000	
98.96	15.2	11058	17.6	10.1	12488	13.2	5.1	13856	7.3	20000	
107.9	13.9	9908	14.4	9.3	10258	10	4.6	11354	5.5	20000	
127.4	11.8	10050	12.4	7.9	10402	8.6	3.9	11733	4.8	20000	
137.4	10.9	10115	11.6	7.3	10468	8	3.6	11910	4.5	20000	
159.4	9.4	10244	10.1	6.3	10684	7	3.1	12263	4	20000	
185	8.1	10374	8.8	5.4	11010	6.2	2.7	12623	3.6	20000	
192.7	7.8	10409	8.5	5.2	11099	6	2.6	12722	3.5	20000	
223.6	6.7	10539	7.4	4.5	11434	5.4	2.2	13093	3.1	20000	
235	6.4	9797	6.5	4.3	10399	4.6	2.1	11934	2.7	20000	
270.2	5.6	10643	6.2	3.7	11112	4.3	1.9	11921	2.3	20000	
329.6	4.6	10258	4.9	3	11128	3.5	1.5	12743	2	20000	
JRP4N...7											
359.5	4.2	15642	6.8	2.8	16279	4.7	1.4	18842	2.7	20000	11
391.2	3.8	15764	6.3	2.6	16578	4.4	1.3	19172	2.6	20000	
461.7	3.2	14336	4.9	2.2	14970	3.4	1.1	17336	2	20000	
491.4	3.1	16094	5.1	2	17403	3.7	1	19575	2.1	20000	
568.4	2.6	16464	4.6	1.8	17944	3.3	0.88	19845	1.8	20000	
645.5	2.3	12997	3.2	1.5	14044	2.3	0.77	15988	1.3	20000	
700.7	2.1	15008	3.4	1.4	16365	2.4	0.71	18879	1.4	20000	
810.4	1.9	15486	3	1.2	16872	2.2	0.62	19271	1.2	20000	
883.9	1.7	13803	2.5	1.1	14900	1.8	0.57	16938	1	20000	
1039	1.4	15905	2.4	0.96	16561	1.7	0.48	17700	0.89	20000	
1110	1.4	14412	2	0.9	15418	1.5	0.45	17656	0.83	20000	
1226	1.2	16903	2.2	0.82	18375	1.6	0.41	19586	0.84	20000	
1342	1.1	14755	1.7	0.75	16075	1.3	0.37	18272	0.71	20000	
1552	0.97	15177	1.5	0.64	16539	1.1	0.32	18757	0.63	20000	
1875	0.8	13067	1.1	0.53	14330	0.8	0.27	16674	0.47	20000	
2023	0.74	16117	1.3	0.49	17360	0.9	0.25	19669	0.51	20000	
2348	0.64	16565	1.1	0.43	17836	0.8	0.21	20000	0.44	20000	
2468	0.61	15148	0.96	0.41	16325	0.69	0.2	18512	0.39	20000	
2837	0.53	14358	0.8	0.35	15701	0.58	0.18	18194	0.34	20000	
3460	0.43	16125	0.73	0.29	17364	0.53	0.14	19665	0.3	20000	



径向力（输出轴）Radial force (Output shafts)

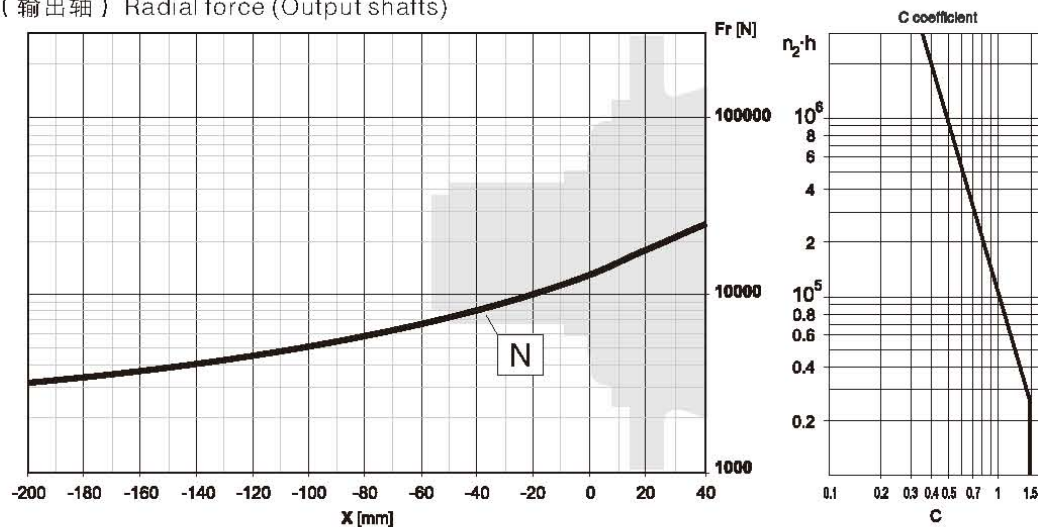


轴向力（输出轴）Axial force (Output shafts)

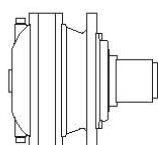


	法兰安装/Flange-mounted
Fa_{din} [N]	68000
Fa_{max} [N]	68000

径向力（输入轴）Radial force (Input shafts)

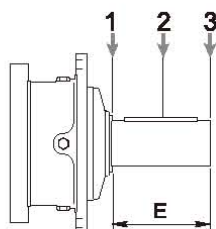

	E	Fr [N]					
		$n_1 \cdot h = 10^7$			$n_1 \cdot h = 10^8$		
		1	2	3	1	2	3
ADM1	105	10000	6000	4000	5000	3000	2000
ADM2	105	14000	8800	6400	7000	4400	3200
ADM3	130	23800	15500	9600	11900	7800	4800

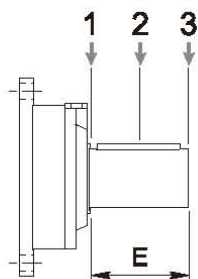

	E	Fr [N]					
		$n_1 \cdot h = 10^7$			$n_1 \cdot h = 10^8$		
		1	2	3	1	2	3
AD2	58	3000	2000	1500	1400	1000	700



JRP...8

i _{eff}	1500			1000			500			T _{2max} [Nm]	P _r [kW]
	n ₂ [rpm]	T ₂ [Nm]	P ₂ [kW]	n ₂ [rpm]	T ₂ [Nm]	P ₂ [kW]	n ₂ [rpm]	T ₂ [Nm]	P ₂ [kW]		
JRP2N...8											
19.5	77	7712	62	51	8709	46.8	25.6	10722	28.8	20000	23
23.4	64	8145	55	42.7	9199	41.2	21.4	11325	25.3	20000	
JRP3N...8											
47.78	31.4	10090	33.2	20.9	11395	25	10.5	13411	14.7	20000	15
56.37	26.6	10604	29.5	17.7	11976	22.2	8.9	13721	12.7	20000	
62.17	24.1	10920	27.6	16.1	12333	20.8	8	13992	11.8	20000	
70.57	21.3	11343	25.3	14.2	12810	19	7.1	14349	10.6	20000	
80.54	18.6	11802	23	12.4	13221	17.2	6.2	14727	9.6	20000	
87.31	17.2	12091	21.8	11.5	13310	16	5.7	14962	9	20000	
100.8	14.9	12624	19.7	9.9	13471	14	5	15388	8	20000	
109.1	13.7	12928	18.6	9.2	13631	13.1	4.6	15627	7.5	20000	
122.4	12.3	13236	17	8.2	13949	11.9	4.1	15978	6.8	20000	
141.4	10.6	13396	14.9	7.1	14353	10.6	3.5	16425	6.1	20000	
161.4	9.3	10255	10	6.2	10710	7	3.1	12291	4	20000	
169.7	8.8	13729	12.7	5.9	14878	9.2	2.9	17006	5.3	20000	
185	8.1	10374	8.8	5.4	11010	6.2	2.7	12623	3.6	20000	
196.8	7.6	9651	7.7	5.1	10030	5.3	2.5	11526	3.1	20000	
223.6	6.7	10539	7.4	4.5	11434	5.4	2.2	13093	3.1	20000	
272.7	5.5	9920	5.7	3.7	10715	4.1	1.8	12286	2.4	20000	

